

Operating Instructions

**RI FB Inside/i
RI MOD/i CC-M40 Profibus DP-V1**

DE | Bedienungsanleitung

EN-US | Operating instructions



42,0410,1920

033-17072024

Inhaltsverzeichnis

Allgemeines	4
Sicherheit.....	4
Anschlüsse und Anzeigen.....	4
Eigenschaften der Datenübertragung.....	5
Konfigurationsparameter.....	6
Roboter-Interface konfigurieren.....	7
Funktion DIP-Schalter	7
Konfiguration der Prozessdaten-Breite.....	7
Knotenadresse einstellen mit DIP-Schalter(Beispiel)	7
Knotenadresse einstellen	9
Die Webseite des Schweißgerätes	9
SmartManager des Schweißgerätes aufrufen und anmelden.....	9
Ein- und Ausgangssignale.....	11
Datentypen.....	11
Verfügbarkeit der Eingangssignale.....	11
Eingangssignale (vom Roboter zum Schweißgerät).....	11
Wertebereich Working mode	17
Wertebereich Processline selection.....	18
Wertebereich TWIN mode.....	18
Wertebereich Documentation mode.....	18
Wertebereich Process controlled correction.....	18
Verfügbarkeit der Ausgangssignale.....	19
Ausgangssignale (vom Schweißgerät zum Roboter).....	19
Zuordnung Sensorstatus 1-4.....	22
Wertebereich Safety status	23
Wertebereich Process Bit.....	23
Wertebereich Function status.....	23
Ein- und Ausgangssignale Retrofit Image	24
Eingangssignale.....	24
Wertebereich Betriebsarten	25
Ausgangssignale.....	25

Allgemeines

Sicherheit




WARNING!

Fehlbedienung und fehlerhaft durchgeführte Arbeiten können schwerwiegende Personen- und Sachschäden verursachen.

Alle in diesem Dokument beschriebenen Arbeiten und Funktionen dürfen nur von geschultem Fachpersonal ausgeführt werden, wenn folgende Dokumente vollständig gelesen und verstanden wurden:

- ▶ dieses Dokument
- ▶ die Bedienungsanleitung des Roboterinterface "RI FB Inside/i"
- ▶ sämtliche Dokumente der Systemkomponenten, insbesondere Sicherheitsvorschriften

Anschlüsse und Anzeigen

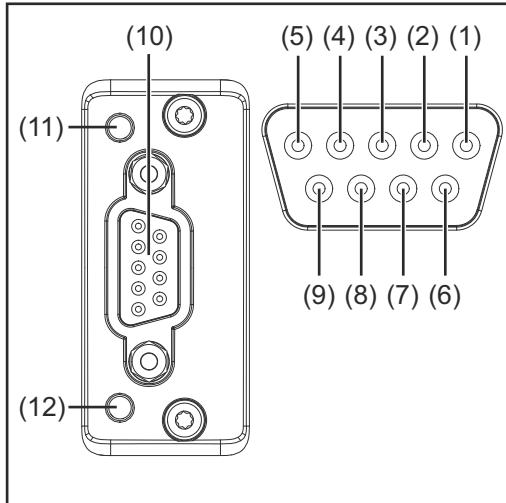

(1) - (9)	Pin-Belegung Profibus DP-V1
(10)	Anschluss Profibus DP-V1
(11)	LED ST (Status)
(12)	LED OP (Betriebsmodus)

Pin-Belegung Anschluss Profibus DP-V1

Pin	Signal	Bedeutung
(1)	-	-
(2)	-	-
(3)	B Line	Positiv RxD/TxD, RS485 Level
(4)	RTS	Sendeanfrage
(5)	GND Bus	Erdung (isoliert)
(6)	+5 V Bus Output	+5 V termination power (isoliert, kurzschlussgeschützt)
(7)	-	-
(8)	A Line	Negativ RxD/TxD, RS485 Level
(9)	-	-
Gehäuse	Kabelschirmung	Entsprechend dem PROFIBUS-Standard intern mit dem Anybus Schutzleiter über Kabelschirmungs-Filter verbunden.

LED ST (Status)	
Status	Bedeutung
Aus	Nicht initialisiert Anybus Status = 'SETUP' oder 'NW_INIT'
Leuchtet grün	Initialisiert Anybus Modul hat den 'NW_INIT' Status verlassen
Blinkt grün	Initialisiert, Diagnose läuft Erweitertes Diagnose-Bit ist gesetzt
Leuchtet rot	Ausnahmefehler Anybus Status = 'EXCEPTION'

OP LED (Betriebsmodus)	
Status	Bedeutung
Aus	Nicht Online oder keine Versorgungsspannung
Leuchtet grün	Datenaustausch
Blinkt grün	Clear
Blinkt rot (1-mal)	Parametrierungs-Fehler
Blinkt rot (2-mal)	Profibus Konfigurationsfehler

Eigenschaften der Datenübertragung

Netzwerk Topologie:

Linearer Bus, aktiver Busabschluss an beiden Enden, Stichleitungen sind möglich

Medium und maximale Buslänge:

Bei der Auswahl der Kabel, Stecker und Abschluss-Widerstände ist die Profibus Installationsrichtlinie für die Planung und Installation von Profibus Systemen zu beachten.

Anzahl der Stationen:

32 Stationen in jedem Segment ohne Repeater. Mit Repeatern erweiterbar bis 127 Stationen.

Übertragungs-Geschwindigkeit:

Wird automatisch vom Busmodul erkannt. Folgende Geschwindigkeiten werden unterstützt:

9,6 kBit/s | 19,2 kBit/s | 45,45 kBit/s | 93,75 kBit/s | 187,5 kBit/s | 500 kBit/s | 1,5 MBit/s | 3 MBit/s | 6 MBit/s | 12 MBit/s

Prozessdaten-Breite:

konfigurierbar am Roboter-Interface RI FB Inside/i
siehe Abschnitt "Roboter-Interface konfigurieren"

Konfigurationsparameter	Bei einigen Roboter-Steuerungen kann es erforderlich sein die hier beschriebenen Konfigurationsparameter anzugeben, damit das Busmodul mit dem Roboter kommunizieren kann.
--------------------------------	--


Parameter	Wert
Vendor Name	Fronius International GmbH
Ident Number	0E2C _{hex} (3628 _{dez})

Die folgenden Parameter geben Detailinformationen über das Busmodul. Auf die Daten kann durch den Profibus-Master mittels azyklischer Lese/Schreib-Dienste zugegriffen werden.

Parameter	Wert
IM Manufacturer ID	01B0 _{hex} (432 _{dez}) Fronius International GmbH
IM Order ID	4.044.014
IM Revision Counter	0001 _{hex} (1 _{dez})
IM Profile ID	F600 _{hex} (62976 _{dez}) Generic Device
IM Profile Specific Type	0004 _{hex} (4 _{dez}) Communication Module
IM Version	0101 _{hex} (257 _{dez})
IM Supported	001E _{hex} (30 _{dez}) IMO..4 supported

Roboter-Interface konfigurieren

Funktion DIP-Schalter

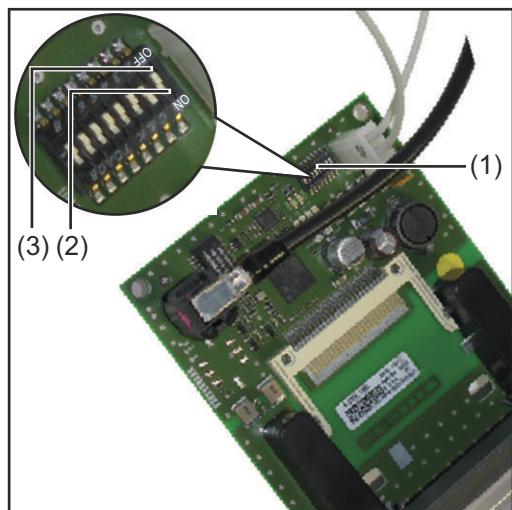

Der DIP-Schalter (1) am Roboter-Interface RI FB Inside/i dient zur Einstellung

- der Prozessdaten-Breite
- der Knotenadresse / IP-Adresse

Werksseitig sind alle Positionen des DIP-Schalters in der Stellung OFF (3). Das entspricht dem binären Wert 0.

Die Stellung ON (2) entspricht dem binären Wert 1.

Konfiguration der Prozessdaten-Breite

DIP-Schalter									Konfiguration
8	7	6	5	4	3	2	1		
OFF	OFF	-	-	-	-	-	-		Standard Image 320 Bit
OFF	ON	-	-	-	-	-	-		Economy Image 128 Bit
ON	OFF	-	-	-	-	-	-		Retro Fit Umfang abhängig von Busmodul
ON	ON	-	-	-	-	-	-		Nicht verwendet

Über die Prozessdaten-Breite wird der Umfang der übertragenen Datenmenge definiert.

Welche Datenmenge übertragen werden kann ist abhängig von

- der Roboter-Steuerung
- der Anzahl der Schweißgeräte
- der Art der Schweißgeräte
 - „Intelligent Revolution“
 - „Digital Revolution“ (Retro Fit)

Knotenadresse einstellen mit DIP-Schalter (Beispiel)

DIP-Schalter									Knotenadresse
8	7	6	5	4	3	2	1		
-	-	OFF	OFF	OFF	OFF	OFF	ON		1
-	-	OFF	OFF	OFF	OFF	ON	OFF		2
-	-	OFF	OFF	OFF	OFF	ON	ON		3
-	-	ON	ON	ON	ON	ON	OFF		62
-	-	ON	ON	ON	ON	ON	ON		63

Die Knotenadresse wird mit den Positionen 1 bis 6 des DIP-Schalters eingestellt.
Die Einstellung erfolgt im Binärformat. Das ergibt einen Einstellbereich von 1 bis 63 im Dezimalformat

HINWEIS!

Nach jeder Änderung der DIP-Schalter Einstellungen ist ein Neustart des Interface durchzuführen, damit die Änderungen wirksam werden.

(Neustart = Unterbrechen und Wiederherstellen der Spannungsversorgung
oder Ausführen der entsprechenden Funktion auf der Webseite des
Schweißgerätes)

Knotenadresse einstellen

Bei Auslieferung ist die Knotenadresse 0 eingestellt. Die Knotenadresse kann auf 2 Arten eingestellt werden:

- Knotenadressen im Bereich von 1 bis 63 können mit dem DIP-Schalter eingestellt werden.
- Wird am DIP-Schalter die Knotenadresse 0 belassen, können Knotenadressen im Bereich von 1 bis 125 nur über folgende Konfigurations-Tools eingestellt werden:
 - die Webseite des Schweißgerätes

HINWEIS!

Wird die Knotenadresse mit dem DIP-Schalter wieder größer 0 gesetzt, ist nach dem nächsten Neustart des Roboter-Interface die entsprechende Knotenadresse im Bereich 1 bis 63 eingestellt.

Eine zuvor von einem Konfigurations-Tool eingestellte KnotenAdresse wird überschrieben.

HINWEIS!

Wurden bereits Einstellungen vorgenommen gibt es 2 Arten um alle Netzwerk-Einstellungen auf Auslieferungszustand zurückzusetzen:

- Alle DIP-Schalter wieder auf 0 setzen und Interface neu starten oder
- Mit dem Button **Restore factory settings** auf der Webseite des Schweißgerätes


Die Webseite des Schweißgerätes

Das Schweißgerät verfügt über eine eigene Webseite, den SmartManager. Sobald das Schweißgerät in einem Netzwerk integriert ist, kann der SmartManager über die IP-Adresse des Schweißgerätes aufgerufen werden.

Abhängig von Anlagenkonfiguration und Software-Erweiterungen enthält der SmartManager folgende Einträge:

- Übersicht
- Update
- Screenshot
- Sichern & Wiederherstellen
- Funktionspakete
- Job-Daten
- Kennlinienübersicht
- RI FB INSIDE/i

SmartManager des Schweißgerätes aufrufen und anmelden

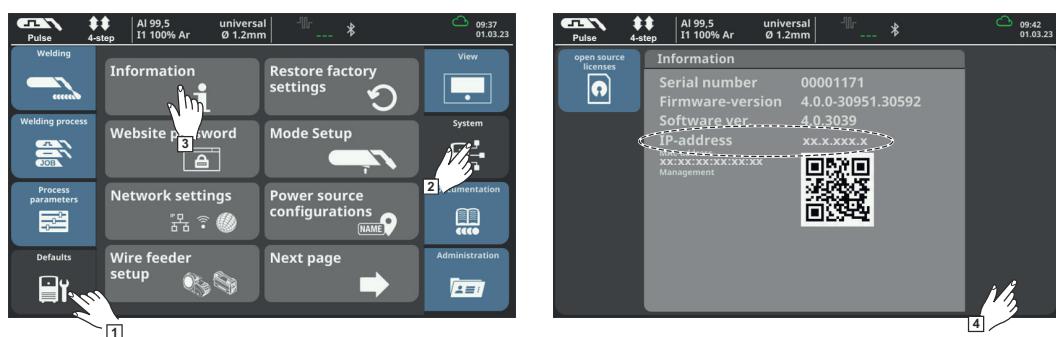

- [1]** Voreinstellungen / System / Information ==> IP-Adresse des Schweißgerätes notieren

2 IP-Adresse im Suchfeld des Browsers eingeben

3 Benutzername und Kennwort eingeben

Werkseinstellung:

Benutzername = admin

Kennwort = admin

4 Angezeigten Hinweis bestätigen

Der SmartManager des Schweißgerätes wird angezeigt.

Ein- und Ausgangssignale

Datentypen	Folgende Datentypen werden verwendet: - UINT16 (Unsigned Integer) Ganzzahl im Bereich von 0 bis 65535 - SINT16 (Signed Integer) Ganzzahl im Bereich von -32768 bis 32767
Umrechnungsbeispiele:	<ul style="list-style-type: none">- für positiven Wert (SINT16) z.B. gewünschter Drahtvorschub x Faktor $12.3 \text{ m/min} \times 100 = 1230_{\text{dez}} = 04CE_{\text{hex}}$- für negativen Wert (SINT16) z.B. gewünschte Lichtbogen-Korrektur x Faktor $-6.4 \times 10 = -64_{\text{dez}} = FFC0_{\text{hex}}$
Verfügbarkeit der Eingangssignale	Die nachfolgend angeführten Eingangssignale sind ab Firmware V4.1.x bei allen Inside/i-Systemen verfügbar.

Eingangssignale (vom Roboter zum Schweißgerät)

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image			
relativ		absolut									
WORD	BYTE	BIT	BIT								
0	0	0	0	Welding Start	steigend			Siehe Tabelle Wertebereich Working mode auf Seite 17			
		1	1	Robot ready	High						
		2	2	Working mode Bit 0	High						
		3	3	Working mode Bit 1	High						
		4	4	Working mode Bit 2	High						
		5	5	Working mode Bit 3	High						
		6	6	Working mode Bit 4	High						
		7	7	—							
	1	0	8	Gas on	steigend			✓	✓		
		1	9	Wire forward	steigend						
		2	10	Wire backward	steigend						
		3	11	Error quit	steigend						
		4	12	Touch sensing	High						
		5	13	Torch blow out	steigend						
		6	14	Processline selection Bit 0	High	Siehe Tabelle Wertebereich Processline selection auf Seite 18					
		7	15	Processline selection Bit 1	High						

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	absolut						
1	2	0	16	Welding simulation	High			✓	✓
		1	17	Beim Schweißverfahren MIG/MAG: ¹⁾ Synchro pulse on	High				
		2	18	Beim Schweißverfahren WIG: ²⁾ TAC on	High				
		3	19	—					
		4	20	—					
		5	21	Booster manual	High				
		6	22	Wire brake on	High				
		7	23	Torchbody Xchange	High				
	3	0	24	—					
		1	25	Teach mode	High				
		2	26	—					
		3	27	—					
		4	28	—					
		5	29	Wire sense start	steigend				
		6	30	Wire sense break	steigend				
		7	31	—					

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	absolut					Standard	Economy
2	4	0	32	TWIN mode Bit 0	High	Siehe Tabelle Wertebereich TWIN mode auf Seite 18	✓	✓	
		1	33	TWIN mode Bit 1	High				
		2	34	—	—	—			
		3	35	—	—	—			
		4	36	—	—	—			
	5	5	37	Documentation mode	High	Siehe Tabelle Wertebereich Documentation mode auf Seite 18			
		6	38	—	—	—			
		7	39	—	—	—			
		0	40	—	—	—			
		1	41	—	—	—			
	5	2	42	—	—	—	✓	✓	
		3	43	—	—	—			
		4	44	—	—	—			
		5	45	—	—	—			
		6	46	—	—	—			
		7	47	Disable process controlled correction	High	—			

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	absolut					Standard	Economy
3	6	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
	7	0	56	ExtInput1 => OPT_Output 1	High			✓	✓
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8-9	0-7	64-79	Welding characteristic- / Job number	UINT16	0 bis 1000	1	✓	✓
5	10 - 11	0-7	80-95	Beim Schweißverfahren MIG/MAG: ¹⁾ Constant Wire: Wire feed speed command value	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
				Beim Schweißverfahren WIG: ²⁾ Main- / Hotwire current command value	UINT16	0 bis 6553,5 [A]	10		
				Beim Job-Betrieb: Power correction	SINT16	-20,00 bis 20,00 [%]	100		

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	BIT					Standard	Economy
6	12 - 13	0-7	96-111	Beim Schweißverfahren MIG/MAG: ¹⁾ Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10	✓	✓
				Beim Schweißverfahren MIG/MAG Standard-Manuell: Welding voltage	UINT16	0,0 bis 6553,5 [V]	10		
				Beim Schweißverfahren WIG: ²⁾ Wire feed speed command value	SINT16	-327,68 bis 327,67 [m/min]	100		
				Beim Job-Betrieb: Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
				Beim Schweißverfahren Constant Wire: Hotwire current	UINT16	0,0 bis 6553,5 [A]	10		
7	14 - 15	0-7	112-127	Beim Schweißverfahren MIG/MAG: ¹⁾ Pulse-/dynamic correction	SINT16	-10,0 bis 10,0 [Schritte]	10	✓	✓
				Beim Schweißverfahren MIG/MAG Standard-Manuell: Dynamic	UINT16	0,0 bis 10,0 [Schritte]	10		
				Beim Schweißverfahren WIG: ²⁾ Wire correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
8	16 - 17	0-7	128-143	Beim Schweißverfahren MIG/MAG: ¹⁾ Wire retract correction	UINT16	0,0 bis 10,0 [Schritte]	10	ü	
				Beim Schweißverfahren WIG: ²⁾ Wire retract end	UINT16	OFF, 1 TO 50 [mm]	1		
9	18 - 19	0-7	144-159	Welding speed	UINT16	0,0 bis 1000,0 [cm/min]	10	✓	

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image					
relativ		absolut						Standard	Economy				
WORD	BYTE	BIT	BIT										
10	20 - 21	0-7	160-175	Process controlled correction		Siehe Tabelle Wertebereich Process controlled correction auf Seite 18	✓						
11	22 - 23	0-7	176-191	Beim Schweißverfahren WIG: ²⁾ Wire positioning start				✓					
12	24 - 25	0-7	192-207	—				✓					
13	26 - 27	0-7	208-223	—				✓					
14	28 - 29	0-7	224-239	—				✓					
15	30 - 31	0-7	240-255	Wire forward / backward length	UINT16	OFF / 1 bis 65535 [mm]	1	✓					
16	32 - 33	0-7	256-271	Wire sense edge detection	UINT16	OFF / 0,5 bis 20,0 [mm]	10	✓					
17	34 - 35	0-7	272-287	—				✓					
18	36 - 37	0-7	288-303	—				✓					
19	38 - 39	0-7	304-319	Seam number	UINT16	0 bis 65535	1	✓					

- 1) MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuell, MIG/MAG PMC, MIG/MAG, LSC
 2) WIG Kaltdraht, WIG Heißdraht

Wertebereich Working mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	Parameteranwahl intern
0	0	0	0	1	Kennlinien Betrieb Sonder 2-Takt
0	0	0	1	0	Job-Betrieb
0	1	0	0	0	Kennlinien Betrieb 2-Takt

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	1	0	0	1	MIG/MAG Standard-Manuell 2-Takt
1	0	0	0	0	Idle Mode
1	0	0	0	1	Kühlmittel-Pumpe stoppen
1	1	0	0	1	R/L-Measurement

Wertebereich Betriebsart

**Wertebereich
Processline
selection**

Bit 1	Bit 0	Beschreibung
0	0	Prozesslinie 1 (default)
0	1	Prozesslinie 2
1	0	Prozesslinie 3
1	1	Reserviert

Wertebereich Prozesslinien-Auswahl

**Wertebereich
TWIN mode**

Bit 1	Bit 0	Beschreibung
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserve

Wertebereich TWIN-Betriebsart

**Wertebereich
Documentation
mode**

Bit 0	Beschreibung
0	Nahnummer von Schweißgerät (intern)
1	Nahnummer von Roboter (Word 19)

Wertebereich Dokumentationsmodus

**Wertebereich
Process control-
led correction**

Prozess	Signal	Aktivität / Datentyp	Wertebereich Einstellbereich	Einheit	Faktor
PMC	Arc length stabilizer	SINT16	-327,8 bis +327,7 0,0 bis +5,0	Volt	10

Wertebereich prozessabhängige Korrektur

Verfügbarkeit der Ausgangssignale	Die nachfolgenden angeführten Ausgangssignale sind ab Firmware V4.1.x bei allen Inside/i-Systemen verfügbar.
--	--

**Ausgangssignale
(vom
Schweißgerät
zum Roboter)**

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz			
		1	1	Power source ready	High				
		2	2	Warning	High				
		3	3	Process active	High				
		4	4	Current flow	High				
		5	5	Arc stable- / touch signal	High				
		6	6	Main current signal	High				
		7	7	Touch signal	High				
0	1	0	8	Collisionbox active	High	O = Kollision oder Kabelbruch		✓	✓
		1	9	Robot motion Release	High				
		2	10	Wire stick workpiece	High				
		3	11	<i>Beim Schweißverfahren WIG: 2) Electrode overload</i>	High				
		4	12	Short circuit contact tip	High				
		5	13	Parameter selection internally	High				
		6	14	Characteristic number valid	High				
		7	15	Torch body gripped	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image			
relativ		absolut						Standard	Economy		
WORD	BYTE	BIT	BIT								
1	2	0	16	Command value out of range	High			✓	✓		
		1	17	Correction out of range	High						
		2	18	—							
		3	19	Limitsignal	High						
		4	20	—							
		5	21	Standby active	High						
		6	22	Main supply status	Low						
	3	7	23	—							
		0	24	Sensor status 1	High	Siehe Tabelle Zuordnung Sensorstatus 1-4 auf Seite 22					
		1	25	Sensor status 2	High						
		2	26	Sensor status 3	High						
		3	27	Sensor status 4	High						
		4	28	—							
		5	29	—							
2	4	6	30	—				✓	✓		
		7	31	—							
		0	32	Function status Bit 0	High	Siehe Tabelle Wertebereich Function status auf Seite 23					
		1	33	Function status Bit 1	High						
		2	34	—							
		3	35	Safety status Bit 0	High	Siehe Tabelle Wertebereich Safety status auf Seite 23					
		4	36	Safety status Bit 1	High						
	5	5	37	—							
		6	38	Notification	High						
		7	39	System not ready	High						
		0	40	—							
		1	41	—							
		2	42	Beim Schweißverfahren WIG: ²⁾ Pulse current active	High						
		3	43	—							
		4	44	Process run	High						
		5	45	—							
		6	46	Active processline Bit 0	High						
		7	47	Active processline Bit 1	High						

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	Process Bit 0	High	Siehe Tabelle Wer-tebereich Process Bit auf Seite 23		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
7	3	0	56	ExtOutput1 <= OPT_Input1	High			✓	✓
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8-9	0-7	64-79	Welding voltage	UINT16	0,0 bis 655,35 [V]	100	✓	✓
5	10 - 11	0-7	80-95	Welding current	UINT16	0,0 bis 6553,5 [A]	10	✓	✓
6	12 - 13	0-7	96-111	Wire feed speed	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
7	14 - 15	0-7	112-27	Actual real value for seam tracking	UINT16	0 bis 6,5535	10000	✓	✓
8	16 - 17	0-7	128-143	Error number	UINT16	0 bis 65535	1	✓	
9	18 - 19	0-7	144-159	Warning number	UINT16	0 bis 65535	1	✓	

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image					
relativ		absolut						Standard	Economy				
WORD	BYTE	BIT	BIT										
10	20 - 21	0-7	160-175	Motor current M1	SINT16	-327,68 bis 327,67 [A]	100	✓					
11	22 - 23	0-7	176-191	Motor current M2	SINT16	-327,68 bis 327,67 [A]	100	✓					
12	24 - 25	0-7	192-207	Motor current M3	SINT16	-327,68 bis 327,67 [A]	100	✓					
13	26 - 27	0-7	208-223	Beim Schweißverfahren WIG: ²⁾ Actual real value AVC	UINT16	0 to 655,35 [V]	100	✓					
14	28 - 29	0-7	224-239	—				✓					
15	30 - 31	0-7	240-255	Resistance	UINT16	0,0 to +400,0 [mOhm]	10	✓					
16	32 - 33	0-7	256-271	Wire position	SINT16	-327,68 bis 327,67 [mm]	100	✓					
17	34 - 35	0-7	272-287	Wire buffer level (nur RI FB PRO/i)	SINT16	-100 bis 100 [%]	1	✓					
18	36 - 37	0-7	288-303	—				✓					
19	38 - 39	0-7	304-319	—				✓					

- 1) MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuell, MIG/MAG PMC, MIG/MAG, LSC
 2) WIG Kaltdraht, WIG Heißdraht

Zuordnung Sensorstatus 1-4

Signal	Beschreibung
Sensor status 1	OPT/i WF R Drahtende (4,100,869)
Sensor status 2	OPT/i WF R Drahtfass (4,100,879)
Sensor status 3	OPT/i WF R Ringsensor (4,100,878)
Sensor status 4	Drahtpufferset CMT TPS/i (4,001,763)

Zuordnung Sensorstatus

**Wertebereich
Safety status**

Bit 1	Bit 0	Beschreibung
0	0	Reserve
0	1	Halt
1	0	Stopp
1	1	Nicht eingebaut / aktiv

Wertebereich Safety status

**Wertebereich
Process Bit**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	kein Prozess oder Parameteranwahl intern
0	0	0	0	1	MIG/MAG Puls-Synergic
0	0	0	1	0	MIG/MAG Standard-Synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG Standard-Manuell
0	0	1	1	0	Elektrode
0	0	1	1	1	WIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire
0	1	0	1	0	ColdWire
0	1	0	1	1	DynamicWire

Wertebereich Process Bit

**Wertebereich
Function status**

Bit 1	Bit 0	Beschreibung
0	0	Inactive
0	1	Idle
1	0	Finished
1	1	Error

Wertebereich Funktionsstatus

Ein- und Ausgangssignale Retrofit Image

Eingangssignale Die nachfolgend angeführten Signale sind ab Firmware V1.6.0 bei allen Inside/i-Systemen verfügbar.

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
E01	Gas Test		High
E02	Drahtvorlauf		High
E03	Drahtrücklauf		High
E04	Error quit		High
E05	Positionssuchen		High
E06	Brenner ausblasen		High
E07	—		
E08	—		
E09	Schweißen ein		High
E10	Roboter bereit		High
E11	Betriebsarten Bit 0	Siehe Tabelle Wertebereich Betriebsarten auf Seite 25	High
E12	Betriebsarten Bit 1		High
E13	Betriebsarten Bit 2		High
E14	—		
E15	—		
E16	—		
E17 - E23	Programmnummer	1 bis 127	
E24	Schweißsimulation		High
E25 - E32	Job-Nummer	0 bis 99	
nur in Betriebsart Jobbetrieb			
E17 - E23	Job-Nummer	0 bis 999	
E24	Schweißsimulation		High
E25 - E32	Job-Nummer	0 bis 255	
E33 - E40	Leistungs-Sollwert - High Byte	0 bis 65535 (0 bis 100 %)	
E41 - E48	Leistungs-Sollwert - Low Byte		
E49 - E56	Lichtbogen-Längenkorrektur, Sollwert High Byte	0 bis 65535 (-30 bis +30 %)	
E57 - E64	Lichtbogen-Längenkorrektur, Sollwert Low Byte		
E65 - E72	—		
E73 - E80	—		
E81 - E88	—		

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
E89 - E96	Puls- oder Dynamikkorrektur	0 bis 255 (-5 bis +5 %)	
E97	Synchro Puls ein		High
E98 - E100	—		
E101	Leistungs-Vollbereich (0 bis 30 m)		High
E102 - E112	—		

Wertebereich Betriebsarten

Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	MIG/MAG Synergic Schweißen
0	0	1	MIG/MAG Synergic Schweißen
0	1	0	Job Betrieb
0	1	1	Parameteranwahl intern

Ausgangssignale

Die nachfolgend angeführten Signale sind ab Firmware V1.6.0 bei allen Inside/i-Systemen verfügbar.

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
A01 - A08	—		
A09	Lichtbogen stabil		High
A10	Limitsignal		High
A11	Prozess aktiv		High
A12	Hauptstrom-Signal		High
A13	Brenner-Kollisionsschutz		High
A14	Stromquelle bereit		High
A15	Kommunikation bereit		High
A16	—		
A17	—		
A18	—		
A19	—		
A20	Draht vorhanden		High
A21	Überschreitung Kurzschlusszeit		High
A22	—		
A23	—		
A24	Leistung außerhalb Bereich		High
A25 - A32	—		

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
A33 - A40	Schweißspannungs-Istwert - High Byte	0 bis 65535 (0 bis 100 V)	
A41 - A48	Schweißspannungs-Istwert - Low Byte		
A49 - A56	Schweißstrom-Istwert - High Byte	0 bis 65535 (0 bis 1000 A)	
A57 - A64	Schweißstrom-Istwert - Low Byte		
A65 - A72	—		
A73 - A80	—		
A81 - A88	—		
A89 - A96	Motorstrom-Istwert	0 bis 255 (0 bis 5 A)	
A97 - A104	Drahtgeschwindigkeit - High Byte	0 bis vDmax	
A105 - A112	Drahtgeschwindigkeit - Low Byte		

Table of contents

General.....	28
Safety	28
Connections and Indicators.....	28
Data Transfer Properties.....	29
Configuration Parameters.....	29
Configuration of robot interface.....	31
Dip-switch function.....	31
Configuration of the process data width	31
Set node address with dip switch(example).....	31
Configuring the Node Address.....	33
The Website of the welding machine	33
Call up the welding machine SmartManager and log in.....	33
Input and output signals.....	35
Data types	35
Availability of Input Signals.....	35
Input signals (from robot to power source)	35
Value Range for Working Mode	41
Value range Process line selection	42
Value Range for TWIN Mode.....	42
Value Range for Documentation Mode.....	42
Value range for Process controlled correction.....	42
Availability of Output Signals.....	43
Output Signals (from Power Source to Robot)	43
Assignment of Sensor Statuses 1–4	46
Value range Safety status.....	47
Value Range for Process Bit.....	47
Value Range for Function status.....	47
Retrofit Image Input and Output Signals	48
Input Signals.....	48
Value Range for Opterating Modes	49
Output Signals	49

General

Safety




WARNING!

Incorrect operation and faulty work can cause serious personal injury and material damage.

All work and functions described in this document must be performed only by trained specialist personnel who have read and understood the following documents in full:

- ▶ this document
- ▶ the Operating Instructions of the robot interface "RI FB Inside/i"
- ▶ all documents relating to system components, especially the safety rules

Connections and Indicators

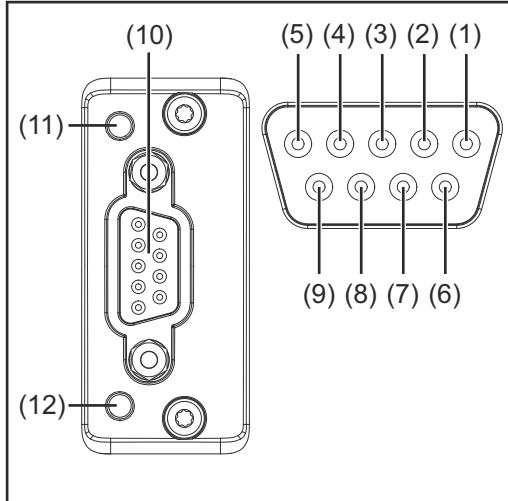

(1) - (9)	Pin assignment Profibus DP-V1
(10)	Profibus connection DP-V1
(11)	ST LED (status)
(12)	OP LED (operating mode)

Pin assignment Profibus connection DP-V1

Pin	Signal	Description
(1)	-	-
(2)	-	-
(3)	B line	Positive RxD/TxD, RS485 Level
(4)	RTS	Send request
(5)	GND bus	Grounding (insulated)
(6)	+5 V Bus Output	+5 V termination power (insulated, short-circuit protection)
(7)	-	-
(8)	A line	Negative RxD/TxD, RS485 Level
(9)	-	-
Housing	cable shielding	Internally connected to the Anybus ground conductor using a cable shielding filter in accordance with the PROFIBUS standard.

ST LED (status)	
Status	Description
Off	Not initialized Anybus status = 'SETUP' or 'NW_INIT'
Lights up green	Initialized Anybus module is no longer in the 'NW_INIT' status
Flashes green	Initialized, diagnosis is running Extended diagnostic bit is set
Lights up red	Exception error Anybus status = 'EXCEPTION'

OP LED (operating mode)	
Status	Description
Off	Not online or no supply voltage
Lights up green	Data exchange
Flashes green	Clear
Flashes red (once)	Parameterization error
Flashes red (twice)	Profibus configuration error

Data Transfer Properties

Network topology:

Linear bus, active bus termination on both ends, stub cables are possible

Medium and maximum bus length:

When selecting the cable, plug, and terminating resistors, the Profibus installation guideline for the planning and installation of Profibus systems must be observed.

Number of stations:

32 stations in each segment without repeaters. With the use of repeaters, this can be increased to 127 stations.

Transmission speed:

Automatically detected by the bus module. The following speeds are supported:

9.6 kBit/s | 19.2 kBit/s | 45.45 kBit/s | 93.75 kBit/s | 187.5 kBit/s | 500 kBit/s | 1.5 MBit/s | 3 MBit/s | 6 MBit/s | 12 MBit/s

Process data width:

Can be configured in the RI FB Inside/i robot interface
see section "Configuration of robot interface"

Configuration Parameters

In some robot control systems, it may be necessary to state the configuration parameters described here so that the bus module can communicate with the robot.


Parameter	Value
Vendor Name	Fronius International GmbH
Ident Number	0E2C _{hex} (3628 _{dec})

The following parameters provide detailed information about the bus module.
The Profibus master can access the data using acyclic read/write services.

Parameter	Value
IM Manufacturer ID	01B0 _{hex} (432 _{dec}) Fronius International GmbH
IM Order ID	4.044.014
IM Revision Counter	0001 _{hex} (1 _{dec})
IM Profile ID	F600 _{hex} (62,976 _{dec}) Generic Device
IM Profile Specific Type	0004 _{hex} (4 _{dec}) Communication module
IM Version	0101 _{hex} (257 _{dec})
IM Supported	001E _{hex} (30 _{dec}) IMO..4 supported

Configuration of robot interface

Dip-switch function

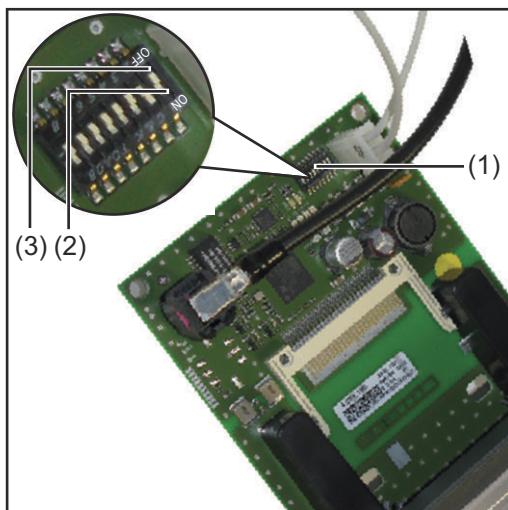

The dip-switch (1) on the robot interface RI FB Inside/i is used to configure

- the process data width
- the node address/IP address

At the factory all positions of the dip switch are set to OFF (3).

This corresponds to the binary value 0.

The position (2) corresponds to the binary value 1.

Configuration of the process data width

Dip switch								Configuration
8	7	6	5	4	3	2	1	
OFF	OFF	-	-	-	-	-	-	Standard image 320 Bit
OFF	ON	-	-	-	-	-	-	Economy image 128 Bit
ON	OFF	-	-	-	-	-	-	Retro Fit Scope dependent on bus module
ON	ON	-	-	-	-	-	-	Not used

The process data width defines the scope of the transferred data volume.

The kind of data volume that can be transferred depends on

- the robot controls
- the number of welding machines
- the type of welding machines
 - "Intelligent Revolution"
 - "Digital Revolution" (Retro Fit)

Set node address with dip switch (example)

Dip switch								Node address
8	7	6	5	4	3	2	1	
-	-	OFF	OFF	OFF	OFF	OFF	ON	1
-	-	OFF	OFF	OFF	OFF	ON	OFF	2
-	-	OFF	OFF	OFF	OFF	ON	ON	3
-	-	ON	ON	ON	ON	ON	OFF	62
-	-	ON	ON	ON	ON	ON	ON	63

The node address is set with positions 1 to 6 of the dip switch.
The configuration is carried out in binary format. This results in a configuration range of 1 to 63 in decimal format

NOTE!

After every change of the configurations of the dip switch settings, the interface needs to be restarted so that the changes will take effect.

(Restart = interrupting and restoring the power supply
or executing the relevant function on the website of the power source)

Configuring the Node Address

Upon delivery the configured node address is 0. The node address can be configured in two ways:

- Node addresses in the range of 1 to 63 can be configured with the dip switch.
- If node address 0 is kept on the dip switch, the node addresses in the range of 1 to 125 can only be configured with the following configuration tools:
 - the website of the welding machine

NOTE!

If the node address is set to higher than 0 with the dip switch, the relevant node address will be configured to the range of 1 to 63 after restarting the robot interface.

A node address previously configured by a configuration tool is overwritten.

NOTE!

If configurations have already been made, the network configurations can be restored to factory settings in two ways:

- set all dip switches back to 0 and restart interface
or
- with the button **Restore factory settings** on the website of the welding machine

The Website of the welding machine


The welding machine has its own website, the SmartManager.

As soon as the welding machine has been integrated into a network, the SmartManager can be opened via the IP address of the welding machine.

Depending on the system configuration and software upgrades, the SmartManager may contain the following entries:

- Overview
- Update
- Screenshot
- Save and restore
- Function packages
- Job data
- Overview of characteristics
- RI FB INSIDE/i

Call up the welding machine SmartManager and log in

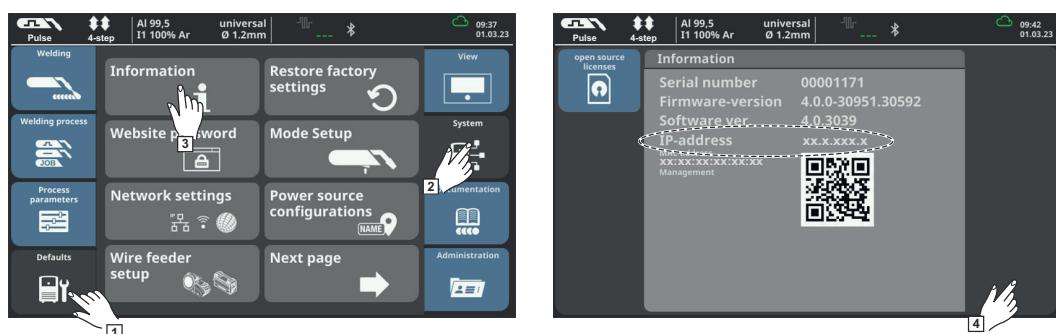

1 Presettings / System/Information ==> note down IP address of the welding machine

2 Enter the IP address into the search field of the browser

3 Enter username and password

Factory setting:
Username = admin
Password = admin

4 Confirm displayed message

The welding machine SmartManager is displayed.

Input and output signals

Data types

The following data types are used:

- **UINT16** (Unsigned Integer)
Whole number in the range from 0 to 65535
- **SINT16** (Signed Integer)
Whole number in the range from -32768 to 32767

Conversion examples:

- for a positive value (SINT16)
e.g. desired wire speed x factor
 $12.3 \text{ m/min} \times 100 = 1230_{\text{dec}} = 04CE_{\text{hex}}$
- for a negative value (SINT16)
e.g. arc correction x factor
 $-6.4 \times 10 = -64_{\text{dec}} = FFC0_{\text{hex}}$

Availability of Input Signals

The input signals listed below are available from firmware V4.1.x for all Inside/i systems.

Input signals (from robot to power source)

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative		Absolu-	te					Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Welding Start	Increasing	See table Value Range for Working Mode on page 41			
		1	1	Robot ready	High				
		2	2	Working mode Bit 0	High				
		3	3	Working mode Bit 1	High				
		4	4	Working mode Bit 2	High				
		5	5	Working mode Bit 3	High				
		6	6	Working mode Bit 4	High				
		7	7	—					
0	1	0	8	Gas on	Increasing	See table Value range Process line selection on page 42		✓	✓
		1	9	Wire forward	Increasing				
		2	10	Wire backward	Increasing				
		3	11	Error quit	Increasing				
		4	12	Touch sensing	High				
		5	13	Torch blow out	Increasing				
		6	14	Processline selection Bit 0	High				
		7	15	Processline selection Bit 1	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative		Absolu-	te					Standard	Economy
WORD	BYTE	BIT	BIT						
1	2	0	16	Welding simulation	High			✓	✓
		1	17	<i>Welding process MIG/MAG:</i> ¹⁾ Synchro pulse on	High				
		2	18	<i>Welding process WIG:</i> ²⁾ TAC on	High				
		3	19	—					
	3	4	20	—					
		5	21	Booster manual	High				
		6	22	Wire brake on	High				
		7	23	Torchbody Xchange	High				
		0	24	—					
		1	25	Teach mode	High				
		2	26	—					
		3	27	—					
		4	28	—					
		5	29	Wire sense start	Increasing				
		6	30	Wire sense break	Increasing				
		7	31	—					

Address				Signal	Activity / data type	Range	Factor	Process image			
Relative		Absolu-	te					Standard	Economy		
WORD	BYTE	BIT	BIT								
2	4	0	32	TWIN mode Bit 0	High	See table Value Range for TWIN Mode on page 42		✓	✓		
		1	33	TWIN mode Bit 1	High						
		2	34	—							
		3	35	—							
		4	36	—							
	5	5	37	Documentation mode	High	See table Value Range for Documentation Mode on page 42					
		6	38	—							
		7	39	—							
		0	40	—							
		1	41	—							
		2	42	—							
		3	43	—							
		4	44	—							
		5	45	—							
		6	46	—							
		7	47	Disable process controlled correction	High						

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative		Absolu-	te					Standard	Economy
WORD	BYTE	BIT	BIT						
3	6	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
	7	0	56	ExtInput1 => OPT_Output 1	High			✓	✓
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8-9	0-7	64-79	Welding characteristic- / Job number	UINT16	0 to 1000	1	✓	✓
5	10 - 11	0-7	80-95	Welding process MIG/MAG: ¹⁾ Constant Wire: Wire feed speed command value	SINT16	-327,68 to 327,67 [m/min]	100	✓	✓
				Welding process WIG: ²⁾ Main- / Hotwire current command value	UINT16	0 to 6553,5 [A]	10		
				For job-mode: Power correction	SINT16	-20,00 to 20,00 [%]	100		

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative		Absolu-	te					Standard	Economy
WORD	BYTE	BIT	BIT						
6	12 - 13	0-7	96-111	Welding process MIG/MAG: ¹⁾ Arclength correction	SINT16	-10,0 to 10,0 [Schritte]	10	✓	✓
				Welding process MIG/MAG Standard-Manuel: Welding voltage	UINT16	0,0 to 6553,5 [V]	10		
				Welding process WIG: ²⁾ Wire feed speed command value	SINT16	-327,68 to 327,67 [m/min]	100		
				For job-mode: Arclength correction	SINT16	-10,0 to 10,0 [Schritte]	10		
				Welding process Constant Wire: Hotwire current	UINT16	0,0 to 6553,5 [A]	10		
7	14 - 15	0-7	112-127	Welding process MIG/MAG: ¹⁾ Pulse-/dynamic correction	SINT16	-10,0 to 10,0 [steps]	10	✓	✓
				Welding process MIG/MAG Standard-Manuel: Dynamic	UINT16	0,0 to 10,0 [steps]	10		
				Welding process WIG: ²⁾ Wire correction	SINT16	-10,0 to 10,0 [steps]	10		
				Welding process MIG/MAG: ¹⁾ Wire retract correction	UINT16	0,0 to 10,0 [steps]	10		
8	16 - 17	0-7	128-143	Welding process WIG: ²⁾ Wire retract end	UINT16	OFF, 1 to 50 [mm]	1	ü	
				Welding speed	UINT16	0,0 to 1000,0 [cm/min]	10		
9	18 - 19	0-7	144-159						

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative		Absolu-	te					Standard	Economy
WORD	BYTE	BIT	BIT						
10	20 - 21	0-7	160-175	Process controlled correction				See table Value range for Process controlled correction on page 42	✓
11	22 - 23	0-7	176-191	Welding process WIG: ²⁾ Wire positioning start					✓
12	24 - 25	0-7	192-207	—					✓
13	26 - 27	0-7	208-223	—					✓
14	28 - 29	0-7	224-239	—					✓
15	30 - 31	0-7	240-255	Wire forward / backward length	UINT16	OFF / 1 to 65535 [mm]	1	✓	
16	32 - 33	0-7	256-271	Wire sense edge detection	UINT16	OFF / 0,5 to 20,0 [mm]	10	✓	
17	34 - 35	0-7	272-287	—					✓
18	36 - 37	0-7	288-303	—					✓
19	38 - 39	0-7	304-319	Seam number	UINT16	0 to 65535	1	✓	

- 1) MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuel, MIG/MAG PMC, MIG/MAG, LSC
 2) WIG coldwire, WIG hotwire

Value Range for Working Mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	Internal parameter selection
0	0	0	0	1	Special 2-step mode characteristics
0	0	0	1	0	Job mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	1	0	0	0	2-step mode characteristics
0	1	0	0	1	2-step MIG/MAG standard manual
1	0	0	0	0	Idle Mode
1	0	0	0	1	Stop coolant pump
1	1	0	0	1	R/L-Measurement

Value range for operating mode

Value range Process line selection

Bit 1	Bit 0	Description
0	0	Process line 1 (default)
0	1	Process line 2
1	0	Process line 3
1	1	Reserved

Value range for process line selection

Value Range for TWIN Mode

Bit 1	Bit 0	Description
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserved

Value range for TWIN mode

Value Range for Documentation Mode

Bit 0	Description
0	Seam number of welding machine (internal)
1	Seam number of robot (Word 19)

Value range for documentation mode

Value range for Process controlled correction

Process	Signal	Activity / data type	Value range configuration range	Unit	Factor
PMC	Arc length stabilizer	SINT16	-327.8 to +327.7 0.0 to +5.0	Volts	10

Value range for process-dependent correction

Availability of Output Signals	The output signals listed below are available from firmware V4.1.x for all Inside/i systems.
---------------------------------------	--

Output Signals (from Power Source to Robot)

Address				Signal	Activity / data type	Range	Factor	Process image					
relative		absolute						Standard	Economy				
WORD	BYTE	BIT	BIT										
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz		✓	✓				
		1	1	Power source ready	High								
		2	2	Warning	High								
		3	3	Process active	High								
		4	4	Current flow	High								
		5	5	Arc stable- / touch signal	High								
		6	6	Main current signal	High								
		7	7	Touch signal	High								
0	1	0	8	Collisionbox active	High	O = collision or cable break							
		1	9	Robot Motion Release	High								
		2	10	Wire stick workpiece	High								
		3	11	—									
		4	12	Short circuit contact tip	High								
		5	13	Parameter selection internally	High								
		6	14	Characteristic number valid	High								
		7	15	Torch body gripped	High								

Address				Signal	Activity / data type	Range	Factor	Process image			
relative		absolute						Standard	Economy		
WORD	BYTE	BIT	BIT								
1	2	0	16	Command value out of range	High			✓	✓		
		1	17	Correction out of range	High						
		2	18	—							
		3	19	Limitsignal	High						
		4	20	—							
		5	21	—							
		6	22	Main supply status	Low						
	3	7	23	—							
		0	24	Sensor status 1	High	See table Assignment of Sensor Statuses 1–4 on page 46	46				
		1	25	Sensor status 2	High						
		2	26	Sensor status 3	High						
		3	27	Sensor status 4	High						
		4	28	—							
		5	29	—							
2	4	6	30	—				✓	✓		
		7	31	—							
		0	32	—							
		1	33	—							
		2	34	—							
		3	35	Safety status Bit 0	High	See table Value range Safety status on page 47	47				
		4	36	Safety status Bit 1	High						
		5	37	—							
		6	38	Notification	High						
	5	7	39	System not ready	High						
		0	40	—							
		1	41	—							
		2	42	—							
		3	43	—							
		4	44	—							
		5	45	—							
		6	46	—							
		7	47	—							

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	Process Bit 0	High	See table Value Range for Process Bit on page 47		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
7	3	0	56	ExtOutput1 <= OPT_Input1	High			✓	✓
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8-9	0-7	64-79	Welding voltage	UINT16	0.0 to 655.35 [V]	100	✓	✓
5	10 - 11	0-7	80-95	Welding current	UINT16	0.0 to 6553.5 [A]	10	✓	✓
6	12 - 13	0-7	96-111	Wire feed speed	SINT16	-327.68 to 327.67 [m/min]	100	✓	✓
7	14 - 15	0-7	112-127	Actual real value for seam tracking	UINT16	0 to 6.5535	10000	✓	✓
8	16 - 17	0-7	128-143	Error number	UINT16	0 to 65535	1	✓	
9	18 - 19	0-7	144-159	Warning number	UINT16	0 to 65535	1	✓	

Address				Signal	Activity / data type	Range	Factor	Process image					
relative		absolute						Standard	Economy				
WORD	BYTE	BIT	BIT										
10	20 - 21	0-7	160-175	Motor current M1	SINT16	-327.68 to 327.67 [A]	100	✓					
11	22 - 23	0-7	176-191	Motor current M2	SINT16	-327.68 to 327.67 [A]	100	✓					
12	24 - 25	0-7	192-207	Motor current M3	SINT16	-327.68 to 327.67 [A]	100	✓					
13	26 - 27	0-7	208-223	—				✓					
14	28 - 29	0-7	224-239	—				✓					
15	30 - 31	0-7	240-255	—				✓					
16	32 - 33	0-7	256-271	Wire position	SINT16	-327.68 to 327.67 [mm]	100	✓					
17	34 - 35	0-7	272-287	—				✓					
18	36 - 37	0-7	288-303	—				✓					
19	38 - 39	0-7	304-319	—				✓					

Assignment of Sensor Statuses 1-4

Signal	Description
Sensor status 1	OPT/i WF R wire end (4,100,869)
Sensor status 2	OPT/i WF R wire drum (4,100,879)
Sensor status 3	OPT/i WF R ring sensor (4,100,878)
Sensor status 4	Wire buffer set CMT TPS/i (4,001,763)

Assignment of sensor statuses

Value range Safety status	Bit 1	Bit 0	Description
	0	0	Reserve
	0	1	Hold
	1	0	Stop
	1	1	Not installed / active

Value range Safety status

Value Range for Process Bit	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
	0	0	0	0	0	No internal parameter selection or process
	0	0	0	0	1	MIG/MAG pulse synergic
	0	0	0	1	0	MIG/MAG standard synergic
	0	0	0	1	1	MIG/MAG PMC
	0	0	1	0	0	MIG/MAG LSC
	0	0	1	0	1	MIG/MAG standard manual
	0	0	1	1	0	Electrode
	0	0	1	1	1	TIG
	0	1	0	0	0	CMT
	0	1	0	0	1	ConstantWire
	0	1	0	1	0	ColdWire
	0	1	0	1	1	DynamicWire

Value Range for Process Bit

Value Range for Function status	Bit 1	Bit 0	Description
	0	0	Inactive
	0	1	Idle
	1	0	Finished
	1	1	Error

Value range for function status

Retrofit Image Input and Output Signals

Input Signals

The signals listed below are available from firmware V1.6.0 for all Inside/i systems.

Seq. no	Signal designation	Range	Action
E01	Gas test		High
E02	Wire feed		High
E03	Wire-return		High
E04	Error quit		High
E05	Position searches		High
E06	Purge the welding torch		High
E07	—		
E08	—		
E09	Welding on		High
E10	Robot ready		High
E11	Operating modes bit 0	See table Value Range for Optering Modes on page 49	High
E12	Operating modes bit 1		High
E13	Operating modes bit 2		High
E14	—		
E15	—		
E16	—		
E17 - E23	Program number	1 to 127	
E24	Welding simulation		High
E25 - E32	Job number	0 to 99	
Only in Job Mode operating mode			
E17 - E23	Job number	0 to 999	
E24	Welding simulation		High
E25 - E32	Job number	0 to 255	
E33 - E40	Set power value - High byte	0 to 65535 (0 to 100%)	
E41 - E48	Set power value - Low byte		
E49 - E56	Arc length correction, set value High byte	0 to 65535 (-30 to +30%)	
E57 - E64	Arc length correction, set value Low byte		
E65 - E72	—		
E73 - E80	—		
E81 - E88	—		
E89 - E96	Pulse or dynamic correction	0 to 255 (-5 to +5%)	
E97	SynchroPulse on		High

Seq. no	Signal designation	Range	Action
E98 - E100	—		
E101	Full power range (0 to 30 m)		High
E102 - E112	—		

Value Range for Operating Modes

Bit 2	Bit 1	Bit 0	Description
0	0	0	MIG/MAG Synergic welding
0	0	1	MIG/MAG Synergic welding
0	1	0	Job mode
0	1	1	Internal parameter selection

Output Signals

The signals listed below are available from firmware V1.6.0 for all Inside/i systems.

Seq. no	Signal designation	Range	Action
A01 - A08	—		
A09	Arc stable		High
A10	Limit signal		High
A11	Process active		High
A12	Main current signal		High
A13	Welding torch collision protection		High
A14	Power source ready		High
A15	Communication ready		High
A16	—		
A17	—		
A18	—		
A19	—		
A20	Wire present		High
A21	Short circuit time exceeded		High
A22	—		
A23	—		
A24	Power out of range		High
A25 - A32	—		
A33 - A40	Welding voltage actual value - High byte	0 to 65535 (0 to 100 V)	
A41 - A48	Welding voltage actual value - Low byte		

Seq. no	Signal designation	Range	Action
A49 - A56	Welding current actual value - High byte	0 to 65535 (0 to 1000 A)	
A57 - A64	Welding current actual value - Low byte		
A65 - A72	—		
A73 - A80	—		
A81 - A88	—		
A89 - A96	Motor current actual value	0 to 255 (0 to 5 A)	
A97 - A104	Wire speed - High byte	0 to vDmax	
A105 - A112	Wire speed - Low byte		



 SPARE PARTS
ONLINE

Fronius International GmbH
Froniusstraße 1
4643 Pettenbach
Austria
contact@fronius.com
www.fronius.com

At www.fronius.com/contact you will find the contact details
of all Fronius subsidiaries and Sales & Service Partners.